


END CAP



DIMENSIONAL DRAWING

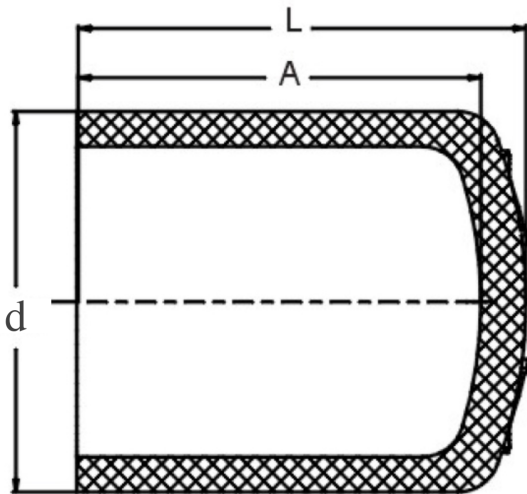

PRODUCT

DIMENSIONS

All dimensions in mm

NO.	SIZE	SDR	d	L	A
1	D20	SDR11	20	–	42
2	D25	SDR11	25	–	42
3	D32	SDR11	32	–	50
4	D40	SDR11	40	–	54
5	D50	SDR11	50	–	55
6	D63	SDR11	63	85	70
7	D75	SDR11	75	100	80
8	D90	SDR11	90	105	80
9	D110	SDR11/SDR17	110	117	90
10	D125	SDR11/SDR17	125	94	77
11	D140 (long)	SDR11/SDR17	140	–	96
12	D140	SDR11	140	96	79
13	D160	SDR11/SDR17	160	137	100
14	D180 (long)	SDR11	180	–	125
15	D180	SDR11	180	108	80

NO.	SIZE	SDR	d	L	A
16	D200	SDR11/SDR17	200	150	112
17	D225	SDR11/SDR17	225	105	80
18	D250	SDR11/SDR17	250	175	135
19	D280	SDR11/SDR17	280	118	90
20	D315	SDR11/SDR17	315	200	150
21	D355	SDR11/SDR17	355	131	90
22	D400	SDR11/SDR17	400	210	165
23	D450	SDR11/SDR17	450	138	90
24	D500	SDR11/SDR17	500	130	90
25	D560	SDR11/SDR17	560	–	225
26	D630	SDR11/SDR17	630	–	225
27	D710	SDR11/SDR17	710	175	137
28	D800	SDR11/SDR17	800	180	143
29	D900	SDR11/SDR17	900	170	120
30	D1000	SDR11/SDR17	1000	175	125

d = outside diameter • all other symbols as shown on the dimensional drawing